

Cable to Reinforcing Steel

Mold Information:

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- For mold Wear Plates, add suffix "WP" to the end of the Mold Part No. See page 270 for details.

Required Tools & Accessories:


- MH1 - Handle for "B" and "P" Price Key Molds
- WRPSLV or CERPM3 - Packing Material
- **CSKITHSVM - Chain Support Kit for #7 and Larger reinforcing steel

Recommended Tools & Accessories:

- CCBRSH1 - Cable Cleaning Brush
- MCBRSH1 - Mold Cleaning Brush

UL 467 Listing:

#6 thru 4/0

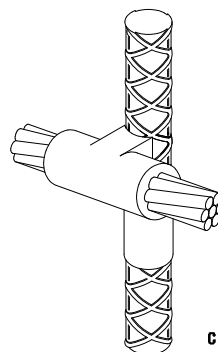

RS

(Horizontal Thru Cable to Side of Vertical Reinforcing Steel)

UL US Listed 467

RS Connection Type

Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
3	#6	RS-36 P	WRPSLV	US90	NUWTUBE90
	#4	RS-34 P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-32 SP	WRPSLV	US90	NUWTUBE90
	#2	RS-32 P	WRPSLV	US90	NUWTUBE90
	1/0	RS-31/0 P	WRPSLV	US115	NUWTUBE115
	2/0	RS-32/0 P	WRPSLV	US115	NUWTUBE115
	3/0	RS-33/0 P	WRPSLV	US150	NUWTUBE150
4	#6	RS-46 P	WRPSLV	US90	NUWTUBE90
	#4	RS-44 P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-42 SP	WRPSLV	US90	NUWTUBE90
	#2	RS-42 P	WRPSLV	US90	NUWTUBE90
	1/0	RS-41/0 P	WRPSLV	US115	NUWTUBE115
	2/0	RS-42/0 P	WRPSLV	US115	NUWTUBE115
	3/0	RS-43/0 P	WRPSLV	US150	NUWTUBE150
5	#6	RS-56 P	WRPSLV	US90	NUWTUBE90
	#4	RS-54 P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-52 SP	WRPSLV	US90	NUWTUBE90
	#2	RS-52 P	WRPSLV	US90	NUWTUBE90
	1/0	RS-51/0 P	WRPSLV	US115	NUWTUBE115
	2/0	RS-52/0 P	WRPSLV	US115	NUWTUBE115
	3/0	RS-53/0 P	WRPSLV	US150	NUWTUBE150
6	#6	RS-66 P	WRPSLV	US90	NUWTUBE90
	#4	RS-64 P	WRPSLV	US90	NUWTUBE90
7** & Larger	#2 Sol	RS-62 SP	WRPSLV	US90	NUWTUBE90
	#2	RS-62 P	WRPSLV	US90	NUWTUBE90
	1/0	RS-61/0 P	WRPSLV	US115	NUWTUBE115
	2/0	RS-62/0 P	WRPSLV	US115	NUWTUBE115
	3/0	RS-63/0 P	WRPSLV	US150	NUWTUBE150
	4/0	RS-64/0 P	WRPSLV	US150	NUWTUBE150
	#6	RS-7L6 B	CERPM3	US90	NUWTUBE90
7** & Larger	#4	RS-7L4 B	CERPM3	US90	NUWTUBE90
	#2 Sol	RS-7L2 SB	CERPM3	US90	NUWTUBE90
	#2	RS-7L2 B	CERPM3	US90	NUWTUBE90
	1/0	RS-7L1/0 B	CERPM3	US115	NUWTUBE115
	2/0	RS-7L2/0 B	CERPM3	US115	NUWTUBE115
	3/0	RS-7L3/0 B	CERPM3	US150	NUWTUBE150
	4/0	RS-7L4/0 B	CERPM3	US150	NUWTUBE150


RS Connection Type continued

Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
6	#6	RS-66 P	WRPSLV	US90	NUWTUBE90
	#4	RS-64 P	WRPSLV	US90	NUWTUBE90
	#2 Sol	RS-62 SP	WRPSLV	US90	NUWTUBE90
	#2	RS-62 P	WRPSLV	US90	NUWTUBE90
	1/0	RS-61/0 P	WRPSLV	US115	NUWTUBE115
	2/0	RS-62/0 P	WRPSLV	US115	NUWTUBE115
	3/0	RS-63/0 P	WRPSLV	US150	NUWTUBE150
7** & Larger	#6	RS-7L6 B	CERPM3	US90	NUWTUBE90
	#4	RS-7L4 B	CERPM3	US90	NUWTUBE90
	#2 Sol	RS-7L2 SB	CERPM3	US90	NUWTUBE90
	#2	RS-7L2 B	CERPM3	US90	NUWTUBE90
	1/0	RS-7L1/0 B	CERPM3	US115	NUWTUBE115
	2/0	RS-7L2/0 B	CERPM3	US115	NUWTUBE115
	3/0	RS-7L3/0 B	CERPM3	US150	NUWTUBE150
7** & Larger	#6	RS-7L6 B	CERPM3	US90	NUWTUBE90
	#4	RS-7L4 B	CERPM3	US90	NUWTUBE90
7** & Larger	#2 Sol	RS-7L2 SB	CERPM3	US90	NUWTUBE90
	#2	RS-7L2 B	CERPM3	US90	NUWTUBE90
	1/0	RS-7L1/0 B	CERPM3	US115	NUWTUBE115
	2/0	RS-7L2/0 B	CERPM3	US115	NUWTUBE115
	3/0	RS-7L3/0 B	CERPM3	US150	NUWTUBE150
	4/0	RS-7L4/0 B	CERPM3	US150	NUWTUBE150
	#6	RS-7L6 B	CERPM3	US90	NUWTUBE90


** Requires #CSKITHSVM Chain Support Kit for welds made to #7 and Larger reinforcing steel.

- (1) #WRPSLV Wrap Sleeve required per weld.
- (1) #CERPM3 Ceramic Packing Material required per weld.

U.S. Patent No. 6,382,496

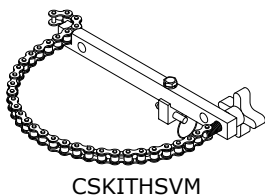

CSKITHSVM

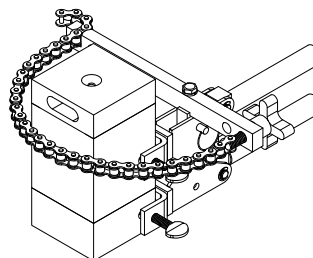

CSKITHSVM with Mold & Handle

Important: See Packing Material Notes On Page 298.