

Cable to Reinforcing Steel

Mold Information:

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number.
i.e. 4S = 4 AWG solid conductor.
- Price Key is the **Bold Letter** in the Mold Part No.
- For information on sizes not listed, please contact the factory.

Required Tools & Accessories:

- MH1 - Handle for "B" Price Key Molds
- WRPSLV - Wrap Sleeve Packing Material

Recommended Tools & Accessories:


- CCBRSH1 - Cable Cleaning Brush
- MCBRSH1 - Mold Cleaning Brush

UL 467 Listing:

- #6 thru 4/0

RB

(Tee of Horizontal Thru
Reinforcing steel &
Horizontal Tap Cable)

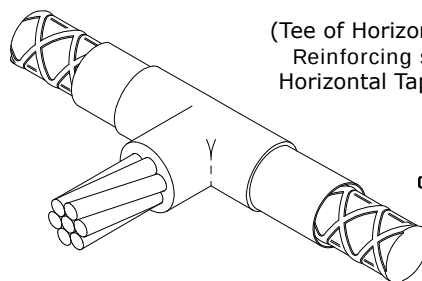

UL US Listed 467

Important: See Packing Material Notes.

RB Connection Type

Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
3	#6	RB-36 B	WRPSLV	US45	NUWTUBE45
	#4	RB-34 B	WRPSLV	US45	NUWTUBE45
	#2 Sol	RB-32 SB	WRPSLV	US65	NUWTUBE65
	#2	RB-32 B	WRPSLV	US65	NUWTUBE65
	1/0	RB-31/0 B	WRPSLV	US90	NUWTUBE90
	2/0	RB-32/0 B	WRPSLV	US90	NUWTUBE90
	3/0	RB-33/0 B	WRPSLV	US115	NUWTUBE115
4	4/0	RB-34/0 B	WRPSLV	US115	NUWTUBE115
	#6	RB-46 B	WRPSLV	US45	NUWTUBE45
	#4	RB-44 B	WRPSLV	US45	NUWTUBE45
	#2 Sol	RB-42 SB	WRPSLV	US65	NUWTUBE65
	#2	RB-42 B	WRPSLV	US65	NUWTUBE65
	1/0	RB-41/0 B	WRPSLV	US90	NUWTUBE90
	2/0	RB-42/0 B	WRPSLV	US90	NUWTUBE90
5	3/0	RB-43/0 B	WRPSLV	US115	NUWTUBE115
	4/0	RB-44/0 B	WRPSLV	US115	NUWTUBE115
	#6	RB-56 B	WRPSLV	US90	NUWTUBE90
	#4	RB-54 B	WRPSLV	US90	NUWTUBE90
	#2 Sol	RB-52 SB	WRPSLV	US90	NUWTUBE90
	#2	RB-52 B	WRPSLV	US90	NUWTUBE90
	1/0	RB-51/0 B	WRPSLV	US115	NUWTUBE115
6	2/0	RB-52/0 B	WRPSLV	US115	NUWTUBE115
	3/0	RB-53/0 B	WRPSLV	US150	NUWTUBE150
	4/0	RB-54/0 B	WRPSLV	US150	NUWTUBE150
	#6	RB-66 B	WRPSLV	US90	NUWTUBE90
	#4	RB-64 B	WRPSLV	US90	NUWTUBE90
	#2 Sol	RB-62 SB	WRPSLV	US90	NUWTUBE90
	#2	RB-62 B	WRPSLV	US90	NUWTUBE90
	1/0	RB-61/0 B	WRPSLV	US115	NUWTUBE115
	2/0	RB-62/0 B	WRPSLV	US115	NUWTUBE115
	3/0	RB-63/0 B	WRPSLV	US150	NUWTUBE150
	4/0	RB-64/0 B	WRPSLV	US150	NUWTUBE150

Packing Material Notes

Packing Material or Wrap Sleeve(s) are necessary when making Ultraweld connections to reinforcing steel. The two types of material used are CERPM or WRPSLV.

CERPM Packing Material is a ceramic fiber material and can be used for one connection only. CERPM is packaged in quantities of 25 per box.

WRPSLV Copper Wrap Sleeve is wrapped around the reinforcing steel for certain connection styles. WRPSLV is packaged in quantities of 50 per box.

Be sure to specify Packing Material No. when ordering Mold and Weld Metal. See pages 323 & 324 for Packing Material.

- (2) #WRPSLV Wrap Sleeves required per weld.