

Cable to Reinforcing Steel

Mold Information:

- Molds listed are for stranded cable. For solid conductor, add suffix "S" after conductor number. i.e. 4S = 4 AWG solid conductor.
- Molds with Price Key "A" SOLD WITH FRAME.
- If Frame not required, add suffix "-X" after the Mold Part No.
- Price Key is the **Bold Letter** in the Mold Part No.

Required Tools & Accessories:


MH1 - Handle for "B" Price Key Molds
WRPSLV or CERPM - Packing Material

Recommended Tools & Accessories:

CCBRSH1 - Cable Cleaning Brush
MCBRSH1 - Mold Cleaning Brush
UMHDKIT - Hold Down Kit

UL 467 Listing:

#6 thru 4/0

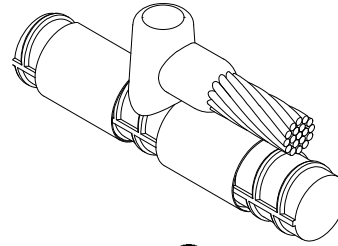

RP

(Parallel Cable Tap of Horizontal Cable to Thru Horizontal Reinforcing Steel)


UL US Listed 467

RP Connection Type

Size	Cable Size	Mold Part No.	Packing Mat'l No.	Weld Metal	
				UltraShot	NUWTUBE
3	#6	RP-36 B	WRPSLV	US25	NUWTUBE25
	#4	RP-34 B	WRPSLV	US32	NUWTUBE32
	#2 Sol	RP-32 SB	WRPSLV	US45	NUWTUBE45
	#2	RP-32 B	WRPSLV	US45	NUWTUBE45
	1/0	RP-31/0 B	WRPSLV	US90	NUWTUBE90
	2/0	RP-32/0 B	WRPSLV	US90	NUWTUBE90
	3/0	RP-33/0 B	WRPSLV	US115	NUWTUBE115
4 & Larger	4/0	RP-34/0 B	WRPSLV	US115	NUWTUBE115
	#6	RP-4L6 A	CERPM1	US25	NUWTUBE25
	#4	RP-4L4 A	CERPM1	US32	NUWTUBE32
	#2 Sol	RP-4L2 SA	CERPM1	US45	NUWTUBE45
	#2	RP-4L2 A	CERPM1	US45	NUWTUBE45
4	1/0	RP-41/0 B	WRPSLV	US90	NUWTUBE90
	2/0	RP-42/0 B	WRPSLV	US90	NUWTUBE90
	3/0	RP-43/0 B	WRPSLV	US115	NUWTUBE115
	4/0	RP-44/0 B	WRPSLV	US115	NUWTUBE115
5	1/0	RP-51/0 B	WRPSLV	US90	NUWTUBE90
	2/0	RP-52/0 B	WRPSLV	US90	NUWTUBE90
	3/0	RP-53/0 B	WRPSLV	US115	NUWTUBE115
	4/0	RP-54/0 B	WRPSLV	US115	NUWTUBE115
6** & Larger	1/0	RP-6L1/0 B	CERPM2	US90	NUWTUBE90
	2/0	RP-6L2/0 B	CERPM2	US90	NUWTUBE90
	3/0	RP-6L3/0 B	CERPM2	US115	NUWTUBE115
	4/0	RP-6L4/0 B	CERPM2	US115	NUWTUBE115


** Requires #UMHDKIT Hold Down Kit for welds made to #6 and Larger reinforcing steel.

- (2) #WRPSLV Wrap Sleeve required per weld.
- (1) #CERPM1 or #CERPM2 Ceramic Packing Material required per weld.



UMHDKIT

U.S. Patent No. 6,382,496

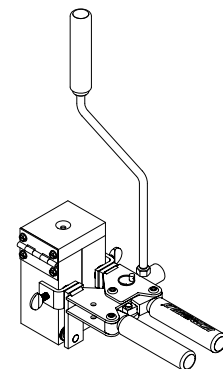

UMHDKIT with Mold & Handle

Important: See Packing Material Notes On Page 298.